

Number: SB21-133

SERVICE BULLETIN

SUBARU CORPORATION

Japan.

Issued: Dec 15, 2021 Customer Quality Dept.

Subject:	Reprogramming Files Availability: Reprogramming for 22MY BRZ P0613		
Applicable Section in Service Manual:	Transmission/Transaxle>AUTOMATIC TRANSMISSION > Transmission Control Module (TCM)		
Applicable Parts name in Parts System:	Transmission > AT, CONTROL UNIT >UNIT-AT CONTROL		
Foreword:	This Service Bulletin is to inform you of the availability of new reprogramming file as countermeasure against DTC P0613 that is set unnecessarily. P0613: TCM PROCESSOR		

1. Applicable Vehicle

Applicable Vehicle	Destination, Specification	MY
BRZ	North America, Europe, General	22

This information is applicable to Japan production vehicles.

2. Details of Symptom and Improvement

Symptom	Details of Symptom and Improvement
Check Engine Light comes on and DTC P0613 is detected.	Details of Symptom, Cause: Under a specific pattern of driving, Transmission Control Unit detects inconsistent gear ratio due to incorrect logic in the self-diagnosis program.
	Details of Improvement: Optimize the self-diagnosis program in the Transmission Control Unit.

3. Production Change Information (Starting VIN)

Applicable Vehicle	Destination, Specification	Starting VIN	
	North America	JF1ZDBB18N9702458	
BRZ	Europe General	LHD	JF1ZD24B3NG002011
	•	RHD	JF1ZD8K72NG002067

For more details of VIN format, refer to "Identification Section" in Service Manual.

4. Reprogramming Files Information

No.	File name	Applicable Vehicle	Destination	Spec.	Old Part Number	Keyword	New CID
1	30319JB151. pfc	22MY BRZ	N. America, C0, C4, U4	2.4L NA, 6AT	30319JB150	-	S2F7070000M
2	30319JB172. pfc	22MY BRZ	N. America, C0, C4, U4	2.4L NA, 6AT	30319JB170 30319JB171	-	S2E7070000M

Reprogramming files will be provided via network for the usage of SSM5R.

Service Bulletin Number: SB21-133

5. Parts Information and Interchangeability

No.		New Parts	Interchangeability	Old Parts	
	Part No.	30319JB151		30319JB150	
1	Part Name	UNIT-AT CONTROL		UNIT-AT CONTROL	
	Note		New Part to Old Vehicle: Yes.	North America	
2	Part No.	30319JB172	Old Part to New Vehicle: No.	30319JB170 30319JB171	
	Part Name	UNIT-AT CONTROL	verlicie. <u>No.</u>	UNIT-AT CONTROL	
	Note			Europe General	

Remarks:

6. Working Procedure

Refer to applicable vehicle Service Manual. The working procedure is not changed.

Refer to <Guideline for reprogramming procedure> on SSM5R (SUBARU Select Monitor 5R) Instruction Manual for the details of reprogramming procedures.

7. Labour Time

Refer to applicable vehicle Flat Rate Data.

END.

CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

SUBARU Service Bulletins are intended for use by professional technicians **ONLY**. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, **DO NOT** assumes that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

Service Bulletin Number: SB21-133